

JD720C Release Notes

Version 1.056.001

Document#:

Welcome to release 1.056.001 of JD720C Cable and Antenna Analyzer: JD723C, JD724C, JD725C, and JD726C. This document provides version numbers, a description of new features, and a list of unresolved issues associated with this release.




Software Version Number

JD720C KKC_FW_1.056.001.FW

Installation instructions

Verifying current version

 Check the current firmware version of your instrument. Turn on the unit, press *Mode* > System key, and then check the firmware version number as shown in the picture below.

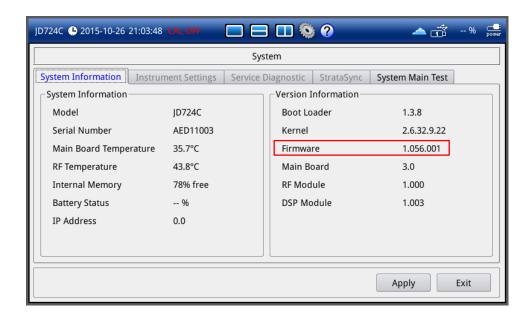

- Visit the linked website below to find the latest firmware and compare it with your version. If your version is older than the latest firmware, download the newest version available.

http://www.viavisolutions.com/en/services-and-support/support/software-downloads-and-updates#Group-C

- Unzip the downloaded firmware file and check the file in .gen file type and a firmware release note in .PDF file type.
- Prepare a USB memory stick with total 4 G Byte or less, supporting FAT32 file system.




Firmware Upgrade Procedure

- Connect AC power adapter to the instrument to prevent any power loss during firmware upgrade, which can cause severe problem or damage to your instrument, requiring a repair.
- Format your USB memory stick to prevent any unexpected error during firmware upgrade.
- Copy and paste the downloaded firmware file in the root directory of the USB memory.
- Plug in the USB memory stick to the USB port placed on the top of your JD720C.
- Press the **Mode** hard key.
- Touch the **System** icon and then the **Apply** button.
- Select the Instrument Setting tab and touch the UBS button for Upgrade.
 The Update window appears.



 Select your downloaded firmware file from the list box by using the Up/Down Arrow keys or the rotary knob to navigate until you find the latest version KKC_FW_1.056.001.FW.

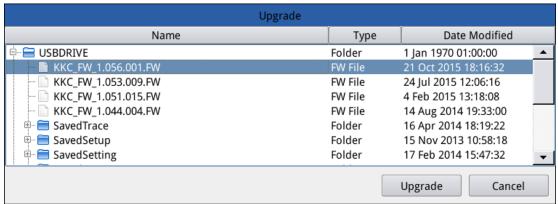

- Touch the **Upgrade** button.
- Select **OK** to confirm or **Cancel** to cancel.



Note: After upgrading to version 1.056.001, the instrument must be restarted in order to complete the installation of updates and performance improvement.



Note: For the firmware version 1.022.001 and before the latest firmware must be upgraded twice: once for firmware upgrade and the other for DSP.

Revision History

<< Version: 1.010.017>>

Date: January 10, 2012

First Release

<< Version: 1.020.008>>

Date: August 10, 2012

New Features

Multilingual Support: English and Korean

Improved to support 731B External Power Sensor

Improvements and Bug Fixes

Improved thermal stability

Enabled full operation with the rotary knob

<< Version: 1.021.004>>

Date: September 28, 2012

New Features

Capability of supporting remote control

Improvements and Bug Fixes

• Improved graphic user interface by changing the typeface.



<< Version: 1.022.001>>

Date: November 21, 2012

New Features

Capability of supporting Chinese

Improvements and Bug Fixes

Improved thermal stability

Compatible Application Software

JDViewer 4.5 or higher

JDRemote 1.3 or higher

<< Version: 1.023.009>>

Date: June 10, 2013

This firmware is also applicable to DS9000.

New Features

Capability of supporting Russian

Improvements and Bug Fixes

- Multi-Segment Line (MSL) Related:
 - Fixed the error that the MSL was still enabled even after changing the frequency settings, giving the user incorrect MSL information and disabling moving the limit.
 - Fixed the error that displayed the incorrect limit values after saving a set limit as a file, which were different from actual information at the time of saving.
 - Fixed the error that the user could load a Cable Loss MSL file created in the JDViewer even if the measurement mode was different. MSL files for Cable Loss and VSWR should have been incompatible.
- Fixed the bug that the instrument disconnected the communication with JDViewer if there was no response from the application for a certain amount of time interval.
- Fixed the error that sub-folders did not appear when the Load menu was selected right after booting.
- Improved the save screen feature so as to capture current menus instead of the Marker menu.

Known Issues

Broken Characters



Description: Right after changing the language in the language option to another one displays strange characters instead of Alt. Sweep.

Compatible Application Software

JDViewer 4.5 or higher

JDRemote 1.3 or higher

<< Version: 1.025.011>>

Date: August 10, 2013

New Features

Capability of supporting French

- Addition of New Limit Window functionality
- Addition of Display Mode and System Shortcut Icons at the Top of the Screen
- Change of Booting Image with CellAdvisor Logo

Improvements and Bug Fixes

- Trace Math:
 - Fixed the bug that the instrument was hung up when the Mode hard key was pressed with the Trace Math window selected as the active window.
- Last Status:
 - Fixed the bug that the Amplitude setting values in the DTF mode were neither saved with Save > Status nor retrieved after rebooting with the Last Status power-on option.
- File Naming Error:
 - Fixed the bug that the files copied by using the HHST program were renamed with the filenames starting with 'capture' by default, losing their original filenames.
- Directory Deletion Error:
 - Fixed the bug that the Delete operation deleted files and subdirectories but not the selected directory (or folder) itself.

Known Issues

- MP-80 Optical Sensor:
 - When the MP-80 Optical Sensor is plugged in, the instrument does not recognize or detect the connected sensor. This issue is under investigation for a solution.

Compatible Application Software

- JDViewer 4.5 or higher
- JDRemote 1.3 or higher



<< Version: 1.026.002>>

Date: August 22, 2013

New Features

- RF Module Power-on:
 - Functionality to control the RF module power by implementing an ECO for it. (Serial Number DDE31501 and after)
 - Pre-work to add a Power Save mode into the next firmware release in order to improve the battery operation time.

Improvements and Bug Fixes

None

Known Issues

- MP-80 Optical Sensor:
 - When the MP-80 Optical Sensor is plugged in, the instrument does not recognize or detect the connected sensor. This issue is under investigation for a solution.

Compatible Application Software

- JDViewer 4.5 or higher
- JDRemote 1.3 or higher

<< Version: 1.030.040>>

Date: November 22, 2013

New Features

- Supportability of Fiber Microscope P5000i
- Supportability of Japanese
- Enhancement of Append Keywords
- Addition of USB TMC Mode
- Addition of Help Feature
- Addition of Save on Event
- Addition of System logging
- Enhancement of Touch Screen
- Supportability of Cloud-based StrataSync
- New Hibernate Mode:
 - When the instrument enters the Hibernate mode, it stops supplying power to the RF module to help save power and improve battery operation time.
- New Pulse Power and Reverse Power measurements with RF Power Meter function



Improvements and Bug Fixes

- Improved Limit Line display when using the Auto Scale hard key:
 - The Auto Scale used to adjust the Y-axis scale based on the current trace only. After this improvement, if the Limit Line is enabled, it optimizes the scale in a way to display both of the entire trace and the limit line.
- MP-80 Optical Sensor:
 - Fixed the bug that the instrument did not recognize or detect the connected MP-80 power sensor.

Known Issues

None

Compatible Application Software

- JDViewer 4.5 or higher
- JDRemote 1.3 or higher

<< Version: 1.040.009>>

Date: January 22, 2014

New Features

- Supportability of global positioning information with an optional GPS Receiver
- Supportability of communication over Bluetooth (optional Bluetooth device package required; Kernel 2.6.32.9.18 required; JDRemote 1.6 or higher required)
- Generation of reports in PDF file type for all measurement modes

Improvements and Bug Fixes

- Improved the supportability of StrataSync to allow uploading PDF files as well.
- Improved the Quick Save function
 - Both a trace and a screen can be saved simultaneously in two separate file types (*.tra and *.png).
 - In a dual display mode, both traces for each measurement display can be saved as two separate files simultaneously.

Known Issues

None

Compatible Application Software

JDViewer 4.5 or higher



■ JDRemote 1.3 or higher

<< Version: 1.041.003>>

Date: January 27, 2014

New Features

None

Improvements and Bug Fixes

- Improved to include pass/fail result in image files to be uploaded to StrataSync.
- Fixed the bug that caused an error in updating firmware from the ftp server or StrataSync.

Known Issues

None

Compatible Application Software

- JDViewer 4.5 or higher
- JDRemote 1.3 or higher

<< Version: 1.042.027>>

Date: April 22, 2014

New Features

None

Improvements and Bug Fixes

- Fixed the error that caused a USB memory stick failed to be recognized. The failure was resulted from the USB chipset change.
- Improved the Quick Save function:
 - Added "Report" to the file type options in Quick Save menu.
 - Changed to allow multiple selections.
- Improved the user interface and operation of the Keyword & Append Keywords.
- Added "AP6012J50" to the list of cables in DTF mode.
- Updated the graphic user interface in both Japanese and Russian.
- Fixed the bug that loading a report file (*.pdf) caused the system hung if JDRemote was connected.



Updated OpenSSL with the version 1.0.1g.

Known Issues

None

Compatible Application Software

JDViewer 5.3

■ JDRemote 1.7

<< Version: 1.043.058>>

Date: August 04, 2014

New Features

New user interface for Optical Power Meter

- New menu added to the report and fiber analysis report
- New option to link OPM readings with a fiber analysis report
- Supportability of new file formats (csv, xml, and html)

Improvements and Bug Fixes

- Improved to display a progress bar when copying or deleting a file in the file manager.
- Created a system directory for StrataSync to upload files only from the folder "/Internal/StrataSync".
- Improved to have the new Bluetooth tab in the System and changed the display to make it easier to connect Bluetooth devices.
- Improved the look of the Instrument Settings tab.
- Improved to display the lastly saved file name in the Save menu when the Power On option is set to Last.
- Improved to load a saved setup file with the CAL status if the stored serial number matches to the one of the current instrument. If not, the instrument will exclude the CAL status from the settings to be loaded.
- Improved to display "Pass" or "Fail" in a big letter for the Limit results.
- Added more SCPI commands.

Known Issues

None

Compatible Application Software

- JDViewer 5.3
- JDRemote 1.7



<< Version: 1.044.004>>

Date: August 25, 2014

New Features

None

Improvements and Bug Fixes

- Corrected the error that displayed the RF temperature incorrectly in the System Information.
- Fixed the bug that caused the system reset when a user attempted to load a status file (.sta) that was saved in the firmware version of 1.030 and later.

Known Issues

None

Compatible Application Software

■ JDViewer 5.3

■ JDRemote 1.7

<< Version: 1.050.020>>

Date: November 07, 2014

New Features

- Supportability of new 2-port hardware JD725C and JD726C with 2-port Transmission Measurement, High Power CW Signal Generator, and Bias Tee options
- Supportability of e-calibration using EZ-Cal
- Supportability of multi-language: German and Spanish
- Protection from high input power

Improvements and Bug Fixes

- Resolved the "POODLE" vulnerability by upgrading the SSL 3.0 Protocol from OpenSSL 1.0.1.g to OpenSSL 1.0.1.j
- Fixed the error in Optical Power Measurement that the reference setting could not controlled with pressing the physical reference button on the connected optical power meter
- Fixed the error in the DTF mode that a Delta Marker position on the Y scale was always



at one (1)

- Fixed the bug that, when the start or stop frequency/distance setting was changed, the limit line kept the previous frequency/distance settings and was not automatically drawn to the far left or right on the chart area
- Fixed the bug in the File Manager that the progress bar stayed up on the screen even after completing Cut and Paste actions and hindered all the hard keys from functioning
- Fixed the bug on the Save tab that the file type "Setup" could not be selected
- Fixed the error that could not initialize JD72450551 and JD72450552 serial power sensors
- Improved the peak and valley search for enabled zoom zones by adding more screen keys including Peak All Zones, Valley All Zones, and Peak and Valley All Zones, and Clear Markers All Zones
- Improved the user interface and usability of the Bluetooth connection
- Improved the save function to allow all traces displayed on the screen in the dual display or zoom zone mode saved individually as a trace file for each
- Changed the on-screen instructions for calibration
- Enhanced the interference rejection
- Added a CAL OFF alert

Known Issues

None

Known Limitations

Current version of JDViewer Release 5.3 is not fully compatible with JD725 and JD726C.

Compatible Application Software

- JDViewer 5.3.04
- JDRemote 1.7

<< Version: 1.051.015>>

Date: February 4, 2015

New Features

None

Improvements and Bug Fixes

- Fixed the error in loading a trace in XLM type
- Improved the marker readings in DTF mode to include delay time
- Improvement in Fiber Inspection mode:
 - Improved the report regeneration feature to enable users to include multiple fibers



(up to 10) in a report

- Improved the usability by removing the Quit menu and by moving Save Report and Save PNG menus into the Save action as new user-selective options
- Enhancement in Save function:
 - Improved the screen save feature (Save/Load or Quick Save) by providing users with options to save the current screen with the Marker menu bar and to save it with the current menu bar at the bottom of the screen
 - Improved to let users save not only the measurement screen but also any current screen
- Enhancement in Limit function:
 - Increased the maximum number of allowed segments for the Multi-Segment Line from 25 to 50
 - Improved the usability by splitting the combined Limit Line menu into Limit Line and MSL
 - Changed to maintain current limit line and to adjust the limit line accordingly to the change of frequency or distance setting
 - Changed to turn off the Limit automatically when the mode is moved from Reflection to DTF
- Updated UI texts and messages in German
- Improved to turn off the Always Peak in the Peak function automatically when the Peak Between (1) or Peak Between (2) in the Marker menu is selected
- Improved the usability by displaying the previous dual measurements back on the screen after changing it to single display and then returning to dual display

Known Issues

None

Known Limitations

None

Compatible Application Software

- JDViewer 5.5
- JDRemote 1.8

<< Version: 1.053.009>>

Date: July 30, 2015

New Features

- Supportability of Internet Protocol version 6 (IPv6) in LAN configuration
- Wi-Fi connectivity using a USB LAN card



Web-based remote control

Improvements and Bug Fixes

- Fixed the bug that caused the Pass/Fail error of optical power measurement on StrataSync
- Changed the mode name of "Alternate Sweep" to "Alt DTF Band"
- Improved the File Manager by
 - Allowing users to select multiple files up to 300
 - Increasing the number of traces to 5000 when requested by JDViewer
- Enhanced the Save function by
 - Increasing the number of stored favorites up to 36
 - Including limit and marker settings when saving a trace or setup
 - Allowing users to type in special characters added to the on-screen keyboard
 - Providing the XML file format option when saving a setup
- Improved the Limit function by
 - Adding settings for the warning on/off and limit value
 - Enabling user to set and display a single limit line in zoom zones
- Improved the UI messaging by adding the message "Calibration is complete. Remove your EZ-Cal kit" after an electronic calibration
- Improved to alert users with a message when the calibration status turns Cal Off because the frequency span got down to less than 2%
- Improved the operation of the Up/Down arrow keys
- Improved the operation of rotary knob and scroll bar in the Band List and Cable List
- Updated multi-language supportability with new UI texts and messages

Known Issues

When starting the instrument, users may experience a broken boot image occasionally.

Known Limitations

None

Compatible Application Software

- JDViewer 5.7
- JDRemote 1.9

<< Version: 1.054.001>>

Date: August 7, 2015

New Features

None



Improvements and Bug Fixes

- Fixed the error that caused the Bias-Tee turned off automatically when the output was set to between 16 V and 32 V.
- According to the change of the company name from JDSU to Viavi Solutions, the startup image was changed to new Viavi image.

Known Issues

• When starting the instrument, users may experience a broken boot image occasionally.

Known Limitations

None

Compatible Application Software

JDViewer 5.7

■ JDRemote 1.9

<< Version: 1.056.001>>

Date: October 29, 2015

New Features

None

Improvements and Bug Fixes

• Fixed a Kernel update error that caused the failure of firmware upgrade in early production units (between Serial number BEF31051 and BEF31080).

Known Issues

• When starting the instrument, users may experience a broken boot image occasionally.

Known Limitations

None

Compatible Application Software

- JDViewer 5.8
- JDRemote 2.0